



TOYOTA LEVIN

VIN:LVG*****2889

2022

1490cc

FWD

CVT

2022 Model TNGA 1.5L CVT Progressive Edition

Inspection Date:2026.05.07

Grade

C



Accident

Accident-Free




Flood Damage

Flood-Free



Fire Damage

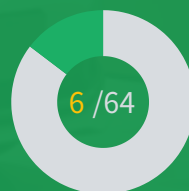

Major Repair

Fire-Free

According to XOYI inspection, the vehicle shows no signs of major structural or reinforced component damage caused by accidents, no flood damage, and no fire damage.



Basic Vehicle Information

Odometer 117752km

Body Type Sedan

Displacement 1490cc

MFG Date 2022-09





Accident Conclusion: Accident-Free

The vehicle’ s structural components, including the front and rear longitudinal members, upper and lower side members, A/B/C/D pillars, and shock absorber mounts, as well as reinforced components such as the firewall, radiator support frame, fender inner structure, and rear panel, have been inspected across 70 accident-detection items. No signs of cutting, welding, replacement, deformation, or body repair were found. Based on the comprehensive evaluation, the vehicle is confirmed to be accident-free.



Left Side Sill:
Scratch marks present



LR Quarter Panel:
Paintwork and body repair
present ≥20cm

Defect Item 8		N/A 8	
! Moderate Defect	! Minor Defect	✓ Accident-Free	
Left Side Sill	!	RF Headlamp Brkt.	✓
LF Headlamp Brkt.	✓	Left Roof Rail	✓
LR Quarter Panel	!	IP Frame	✓
LR Inner Fender Str.	✓	RR Inner Fender Str.	✓
Rear Panel	✓	LR Tail Lamp Brkt.	✓
LR Fender Drain Ch.	✓	LR Shock Mount	✓
LR Fender Liner	✓	Airbag	N/A
RR Shock Mount	✓	RR Fender Liner	✓



Accident Conclusion: Accident-Free



RR Quarter Panel:
Paintwork and body repair
present $\geq 20\text{cm}$



Right Side Sill:
Scratch marks present



Rad Support:
Deformation $\geq 20\text{ cm}$ present




RF Long. Member Flange:
Deformation $\geq 3\text{ cm}^2$ present

Defect Item 8		N/A 8	
⚠ Moderate Defect	⚠ Minor Defect	✅ Accident-Free	
RR Tail Lamp Brkt.	✅	LR Long. Member	✅
RR Long. Member	✅	RR Fender Drain Ch.	✅
RR Quarter Panel	⚠	Right Roof Rail	✅
Trunk Floor Panel	✅	Firewall	✅
RH B-Pillar Inner	✅	LH B-Pillar Inner	✅
Floor Crossmember	N/A	Right Side Sill	⚠
FLM	N/A	Roof Panel	✅
RR Parcel Shelf (Metal)	✅	LF Door Weatherstrip	✅
LR Door Weatherstrip	✅	LF Long. Member	✅
RF Door Weatherstrip	✅	RF Long. Member	✅
RR Door Weatherstrip	✅	LF Crash Box	✅
RF Crash Box	✅	Rad Support	⚠
LF Shock Mount	✅	RF Shock Mount	✅
LF Inner Fender Str.	✅	RF Inner Fender Str.	✅
Instrument Panel	✅	LF Seat Belt	✅
RH A-Pillar Outer	✅	RH A-Pillar Inner	✅
LF Long. Member Flange	✅	RF Long. Member Flange	⚠
LR Long. Member Flange	✅	RR Long. Member Flange	✅



Accident Conclusion: Accident-Free

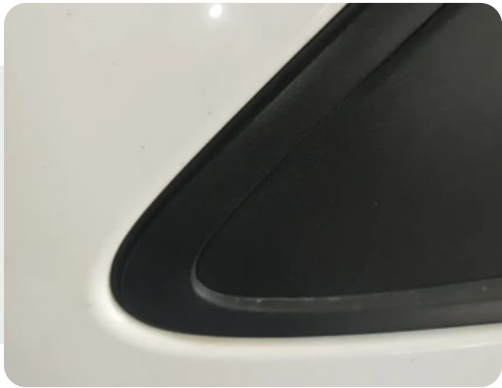

RH C-Pillar Outer:
Paint repair present



LH C-Pillar Outer:
Paint repair present

Defect Item 8		N/A 8	
! Moderate Defect		! Minor Defect	✓ Accident-Free
RF Seat Belt	✓	RH B-Pillar Outer	✓
RH C-Pillar Outer	!	RH C-Pillar Inner	✓
FBR	✓	RR Seat Belt	✓
Floor Pan	N/A	RH D-Pillar Outer	N/A
RH D-Pillar Inner	N/A	RBR	✓
LH D-Pillar Outer	N/A	LH D-Pillar Inner	N/A
LH C-Pillar Outer	!	LH C-Pillar Inner	✓
LH B-Pillar Outer	✓	LR Seat Belt	✓
LH A-Pillar Outer	✓	LH A-Pillar Inner	✓



Flood Damage Result: Flood-Free

This vehicle has undergone inspection of 31 flood-related items, including seat rails and foam, seat belts, carpets, body cavities, vehicle floor pan, as well as associated wiring harnesses and electrical components. No traces of rust, sediment, water accumulation, discoloration, or mold caused by water intrusion were found. Based on a comprehensive evaluation, the vehicle is determined to be a non-flood-damaged vehicle.



Defect Item 1

N/A 0

! Flood Defect ✓ Flood-Free

LH Sill Inner Cavity	✓	RH Sill Inner Cavity	✓
LH Sill Harness	✓	RH Sill Harness	✓
RR Seat Frame & Foam	✓	OBD Port	✓
DS Seat Rail & Frame	!	PS Seat Rail & Frame	✓
LH Foot Vent	✓	RH Foot Vent	✓
TR Floor HAR & Fuse Box	✓	RR Seat Belt Buckle	✓
LR Seat Belt Buckle	✓	Eng. Comp. Conn.	✓
IP Frame	✓	Trunk Floor Panel	✓



DS Seat Rail & Frame:
Evidence of disassembly present



Flood Damage Result: Flood-Free

Defect Item 1		N/A 0	
! Flood Defect		✓ Flood-Free	
LF Floor NVH & Sealer	✓	LH FCM Inner	✓
LR Floor NVH & Sealer	✓	RF Floor NVH & Sealer	✓
RH FCM Inner	✓	IP Air Vent	✓
RR Floor NVH & Sealer	✓	ENG Fuse Box	✓
RF Carpet & Trim	✓	Headliner	✓
CL Socket	✓	Steering Column	✓
RR Carpet & Trim	✓	LR Carpet & Trim	✓
LF Carpet & Trim	✓		



Fire Damage Result: Fire-Free

This vehicle has undergone inspection of 23 fire-damage-related items, including engine compartment pipelines, cabin wiring harnesses and trim panels, fuel tank and fuel lines, trunk wiring harnesses and trim panels, as well as full vehicle exterior and interior coverings. No signs of soot, scorching, burning, charring, or melting caused by fire were found. Based on a comprehensive evaluation, the vehicle is determined to be a non-fire-damaged vehicle.



Defect Item 0		N/A 2	
⚠ Moderate Defect	✔ Fire-Free		
TR Floor HAR & Fuse Box	✔	LR Fender Liner	✔
RR Fender Liner	✔	Body Exterior Panels	✔
Eng. Insulation Pad	✔	ENG Hoses & Lines	✔
ENG Plastic Parts	✔	Cabin Trim Panels	✔
Cabin HAR & Conn.	✔	Trunk	✔
Battery & Acc.	✔	IP & Acc.	✔
RF Shock Mount Sealer	✔	LF Shock Mount Sealer	✔
Fuel Tank & Lines	N/A	ENG HAR & Labels	✔



Fire Damage Result: Fire-Free

XO

Defect Item 0		N/A 2	
!	Moderate Defect	✓	Fire-Free
Driver Seat	✓	ENG Fuse Box	✓
FW Insulation Pad	✓	RR Seat	✓
Front Passenger Seat	✓	Floor Pan	N/A
TR Trim Panel	✓		

Interior and Function Inspection




Defect Item 6

N/A 3


 Minor Defect

 No Damage

LH Sill Inner Cavity		RH Sill Inner Cavity	
LH Sill Harness		RH Sill Harness	
LF Door Trim		RR Seat Frame & Foam	
OBD Port		DS Seat Rail & Frame	
PS Seat Rail & Frame		LR Door Trim	
LH Foot Vent		RH Foot Vent	
TR Floor HAR & Fuse Box		RR Seat Belt Buckle	
Power Window System		LR Seat Belt Buckle	
IP Frame		Trunk Lid Trim	
Airbag	N/A	Cabin Trim Panels	
Cabin HAR & Conn.		Trunk	

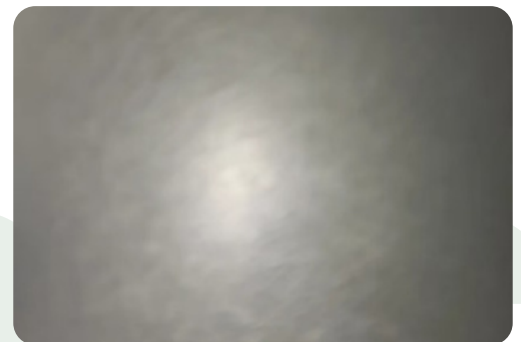

LF Door Trim:
Scratches and stains present

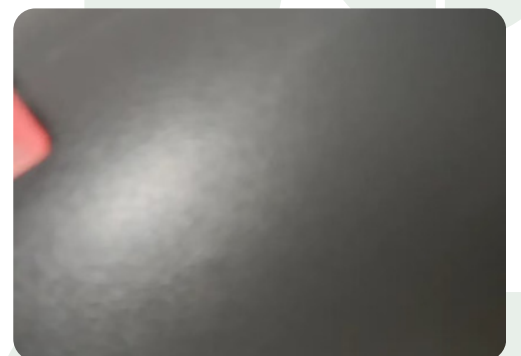

LR Door Trim:
Scratches present

Interior and Function Inspection

Defect Item 6		N/A 3	
 Minor Defect		 No Damage	
Battery & Acc.		IP & Acc.	
RF Shock Mount Sealer		LF Shock Mount Sealer	
Trunk Floor Panel		RR Door Trim	
A-Pillar Trim		B-Pillar Trim	
C-Pillar Trim		RF Door Trim	
RH Sun Visor		LH Sun Visor	
Headliner Grab Handle		Headlamp Control System	
Turn Signal System		LF Door Weatherstrip	
LR Door Weatherstrip		RF Door Weatherstrip	
RR Door Weatherstrip		D-Pillar Trim	N/A
LF Floor NVH & Sealer		LH FCM Inner	
LR Floor NVH & Sealer		Instrument Panel	
Driver Seat		LF Seat Belt	
RF Floor NVH & Sealer		RH FCM Inner	
IP Air Vent		RR Floor NVH & Sealer	
LF Door Inner Handle		Sunroof Control System	N/A
Infotainment SYS		RR Seat	



RR Door Trim:
Scratches present



A-Pillar Trim:
Stains present



B-Pillar Trim:
Scratches present



RF Door Trim:
Scratches present

Interior and Function Inspection

Defect Item 6		N/A 3	
 Minor Defect		 No Damage	
LR Door Inner Handle		RR Door Inner Handle	
Front Passenger Seat		RF Carpet & Trim	
RF Door Inner Handle		RF Seat Belt	
Glove Box		Headliner	
CL Socket		RR Seat Belt	
RR Carpet & Trim		TR Trim Panel	
LR Seat Belt		LR Carpet & Trim	
LF Carpet & Trim			



Engine Inspection



Engine Exterior:
Signs of leakage present



Eng. Valve Cover:
Oil leakage present

Defect Item 3

N/A 1

Moderate Defect		Minor Defect		No Damage	
Eng. Comp. Conn.	✓	ENG Hoses & Lines	✓		
ENG Plastic Parts	✓	Engine Exterior	!		
Fuel Tank & Lines	N/A	Eng. Valve Cover	!		
Engine Front Cover	!	ENG HAR & Labels	✓		
ENG Fuse Box	✓				



Engine Front Cover:
Oil leakage present

▶ Chassis Inspection



Defect Item 1

N/A 0



Moderate Defect



No Damage

Trans. Valve Body Cover



Trans. Exterior



Transmission Case



Steering Column



Transmission Case:
Signs of leakage present

TION